


| Size | 90 | 125 | 160 | 200 |
|--|--------------------|--------------------|--------------------|--------------------|
| Arnold Mat Mechanical | 020 120 090 | 020 120 125 | 020 120 160 | 020 120 200 |
| Arnold Mat Mechanical with power preset | | 020 130 125 | 020 130 160 | 020 130 200 |
| Clamping force (kN) | 25 | 40 | 50 | 50 |
| A | 300 | 410 | 570 | 570 |
| B | 387 | 524 | 679 | 679 |
| B (with power preset) | | 551 | 706 | 706 |
| C - 0,02 | 75 | 100 | 110 | 110 |
| D | 115 | 140 | 160 | 173 |
| E | 91 | 126 | 161 | 201 |
| F | 21 | 21 | 21 | 21 |
| G H7 | 20 | 24 | 24 | 24 |
| H | 70 | 100 | 115 | 119 |
| I | 67 | 124 | 128 | 132 |
| J + 0,02 | 40 | 90 | 115 | 111 |
| K | 110 | 190 | 230 | 230 |
| L | 40 | 50 | 60 | 60 |
| M H7 | 20 | 20 | 20 | 20 |
| N | 40 | 40 | 50 | 63 |
| U | 38 | 54 | 68 | 68 |
| V | 11 | 13 | 13 | 13 |
| W | 90 | 125 | 140 | 140 |
| X | 150 | 195 | 300 | 300 |
| Weight (kg) | 16 | 35 | 70 | 93 |
| Clampings | 90 | 125 | 160 | 200 |
| Clamping field O1 | 0-128 | 0-200 | 0-310 | 0-302 |
| Clamping field O2 | 76-204 | 80-285 | 106-416 | 114-416 |
| Clamping field O3 | | 155-355 | 174-484 | 182-484 |
| Clamping field O4 | 118-172 | 122-191 | 165-334 | 169-334 |
| Clamping field O5 | | 192-261 | 233-402 | 237-402 |
| Spare spindle | 90 | 125 | 160 | 200 |
| Arnold Mat Mechanical | 812 000 090 | 812 000 125 | 812 000 160 | 812 000 200 |
| Arnold Mat Mechanical with power preset | | 813 000 125 | 813 000 160 | 813 000 200 |

Clamping possibilities



Clamping field O1

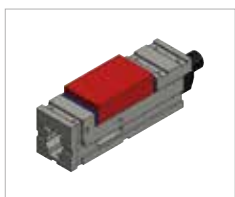

Clamping field O2



Clamping field O3



Clamping field O4



Clamping field O5

Zero point system preinstallation

This vice includes preinstallation for **O-MAK** zero point system.

