

Size	90	125	125 L	125 XL
Arnold SC 5X	050 210 090	050 210 125	050 212 125	050 213 125
Clamping force:	16 kN / 60 Nm	26 kN / 120 Nm	26 kN / 120 Nm	26 kN / 120 Nm
A	250	350	450	550
C	100	103	103	103
D	155	214,5	214,5	214,5
E	90	125	125	125
K	115	165	215	265
M H7	20	20	20	20
N	55	111,5	111,5	111,5
U	71	100	100	100
V	11	11	11	11
X	100	150	189	252
Y	25	39,5	39,5	39,5
Z	5	8	8	8
Weight (kg)	17	37	45	50
Clampings	90	125	125 L	125 XL
Clamping field O1	10-63	18-114	18-114	18-214
Clamping field O2	63-129	114-210	210-306	210-406
Clamping field O3	127-197	144-240	144-240	144-340
Clamping field O4	195-261	240-336	336-432	336-532
Spare spindle	90	125	125 L	125 XL
Arnold SC 5X	905 160 090	905 160 125	905161125	905162125


Clamping possibilities




Clamping field O1



Clamping field O2

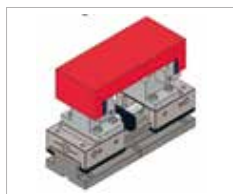

Clamping field O3

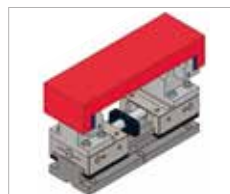

Clamping field O4

Zero point system preinstallation

This vice includes preinstallation for **O-MAK** zero point system.

